Owner's Manual & Safety Instructions

Save This Manual Keep this manual for the safety warnings and precautions, assembly, operating, inspection, maintenance and cleaning procedures. Write the product's serial number in the back of the manual (or month and year of purchase if product has no number). Keep this manual and the receipt in a safe and dry place for future reference.

22k



22201E-B

5-SPEED 10" DRILL PRESS



Visit our website at: http://www.harborfreight.com Email our technical support at: productsupport@harborfreight.com

58782

When unpacking, make sure that the product is intact and undamaged. If any parts are missing or broken, please call 1-888-866-5797 as soon as possible.

Copyright[©] 2022 by Harbor Freight Tools[®]. All rights reserved.

No portion of this manual or any artwork contained herein may be reproduced in any shape or form without the express written consent of Harbor Freight Tools.

Diagrams within this manual may not be drawn proportionally. Due to continuing improvements, actual product may differ slightly from the product described herein.

Tools required for assembly and service may not be included.

AWARNING

Read this material before using this product. Failure to do so can result in serious injury. SAVE THIS MANUAL.

Table of Contents

Important Safety Information2	Maintenance and Servicing 12
Specifications5	Parts List and Diagram14
Setup - Before Use5	Warranty 16
Operating Instructions9	

	WARNING SYMBOLS AND DEFINITIONS
A	This is the safety alert symbol. It is used to alert you to potential personal injury hazards. Obey all safety messages that follow this symbol to avoid possible injury or death.
▲ DANGER	Indicates a hazardous situation which, if not avoided, will result in death or serious injury.
▲ WARNING	Indicates a hazardous situation which, if not avoided, could result in death or serious injury.
ACAUTION	Indicates a hazardous situation which, if not avoided, could result in minor or moderate injury.
NOTICE CAUTION	Addresses practices not related to personal injury.

IMPORTANT SAFETY INFORMATION

General Tool Safety Warnings

AWARNING

Read all safety warnings and instructions.

Failure to follow the warnings and instructions may result in electric shock, fire and/or serious injury. Save all warnings and instructions for future reference.

- 1. KEEP GUARDS IN PLACE and in working order.
- REMOVE ADJUSTING KEYS AND WRENCHES. Form habit of checking to see that keys and adjusting wrenches are removed from tool before turning it on.
- KEEP WORK AREA CLEAN.
 Cluttered areas and benches invite accidents.
- DON'T USE IN DANGEROUS ENVIRONMENT.
 Don't use power tools in damp or wet locations, or expose them to rain. Keep work area well lighted.
- KEEP CHILDREN AWAY. All visitors should be kept safe distance from work area.
- MAKE WORKSHOP KID PROOF with padlocks, master switches, or by removing starter keys.
- DON'T FORCE TOOL. It will do the job better and safer at the rate for which it was designed.
- USE RIGHT TOOL. Don't force tool or attachment to do a job for which it was not designed.

Table A: RECOMMENDED MINIMUM WIRE GAUGE FOR EXTENSION CORDS (120 VOLT)				
NAMEPLATE AMPERES	EXTENSION CORD LENGTH			
(at full load)	25′	50′	100′	150′
0 – 6	18	16	16	14
6.1 – 10	18	16	14	12
10.1 – 12	16	16	14	12
12.1 – 16	14	12	Do not use.	

9. USE PROPER EXTENSION CORD. Make sure your extension cord is in good condition. When using an extension cord, be sure to use one heavy enough to carry the current your product will draw. An undersized cord will cause a drop in line voltage resulting in loss of power and overheating. Table A shows the correct size to use depending on cord length and nameplate ampere rating. If in doubt, use the next heavier gauge. The smaller the gauge number, the heavier the cord.

General Tool Safety Warnings (continued)

- 10. WEAR PROPER APPAREL. Do not wear loose clothing, gloves, neckties, rings, bracelets, or other jewelry which may get caught in moving parts. Nonslip footwear is recommended. Wear protective hair covering to contain long hair.
- 11. ALWAYS USE SAFETY GLASSES. Also use face or dust mask if cutting operation is dusty. Everyday eyeglasses only have impact resistant lenses, they are NOT safety glasses.
- 12. SECURE WORK. Use clamps or a vise to hold work when practical. It's safer than using your hand and it frees both hands to operate tool.
- 13. DON'T OVERREACH. Keep proper footing and balance at all times.
- 14. MAINTAIN TOOLS WITH CARE. Keep tools sharp and clean for best and safest performance. Follow instructions for lubricating and changing accessories.
- 15. DISCONNECT TOOLS before servicing; when changing accessories, such as blades, bits, cutters, and the like.
- REDUCE THE RISK OF UNINTENTIONAL STARTING. Make sure switch is in off position before plugging in.

- 17. USE RECOMMENDED ACCESSORIES.

 Consult the owner's manual for recommended accessories. The use of improper accessories may cause risk of injury to persons.
- 18. NEVER STAND ON TOOL. Serious injury could occur if the tool is tipped or if the cutting tool is unintentionally contacted.
- 19. CHECK DAMAGED PARTS. Before further use of the tool, a guard or other part that is damaged should be carefully checked to determine that it will operate properly and perform its intended function check for alignment of moving parts, binding of moving parts, breakage of parts, mounting, and any other conditions that may affect its operation. A guard or other part that is damaged should be properly repaired or replaced.
- 20. DIRECTION OF FEED. Feed work into a blade or cutter against the direction of rotation of the blade or cutter only.
- 21. NEVER LEAVE TOOL RUNNING UNATTENDED. TURN POWER OFF. Don't leave tool until it comes to a complete stop.

Grounding Instructions



AWARNING

TO PREVENT ELECTRIC SHOCK AND DEATH FROM INCORRECT GROUNDING WIRE CONNECTION


READ AND FOLLOW THESE INSTRUCTIONS:

110-120 VAC Grounded Tools: Tools with Three Prong Plugs

- In the event of a malfunction or breakdown, grounding provides a path of least resistance for electric current to reduce the risk of electric shock. This tool is equipped with an electric cord having an equipment-grounding conductor and a grounding plug. The plug must be plugged into a matching outlet that is properly installed and grounded in accordance with all local codes and ordinances.
- Do not modify the plug provided if it will not fit the outlet, have the proper outlet installed by a qualified electrician.
- Improper connection of the equipment-grounding conductor can result in a risk of electric shock.
 The conductor with insulation having an outer surface that is green with or without yellow stripes is the equipment-grounding conductor.

- If repair or replacement of the electric cord or plug is necessary, do not connect the equipmentgrounding conductor to a live terminal.
- Check with a qualified electrician or service personnel if the grounding instructions are not completely understood, or if in doubt as to whether the tool is properly grounded.
- 5. Use only 3-wire extension cords that have 3-prong grounding plugs and 3-pole receptacles that accept the tool's plug.
- 6. Repair or replace damaged or worn cord immediately.

110-120 VAC Grounded Tools: Tools with Three Prong Plugs (cont.)

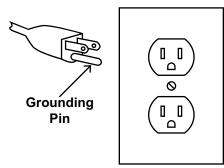

125 VAC 3-Prong Plug and Outlet (for up to 125 VAC and up to 15 A)

- 7. This tool is intended for use on a circuit that has an outlet that looks like the one illustrated above in 125 VAC 3-Prong Plug and Outlet. The tool has a grounding plug that looks like the plug illustrated above in 125 VAC 3-Prong Plug and Outlet.
- 8. The outlet must be properly installed and grounded in accordance with all codes and ordinances.
- Do not use an adapter to connect this tool to a different outlet.

Drill Press Safety Warnings

For Your Own Safety Read Instruction Manual Before Operating Drill Press

- 1. Wear eye protection.
- 2. Do not wear gloves, necktie, or loose clothing.
- Clamp workpiece or brace against column to prevent rotation.
- Use recommended speed for drill accessory and workpiece material.
- The included chuck key is specially designed to be self-ejecting, reducing the risk of ejecting at high speed. Only use the included chuck key or an identical replacement key.
- 6. DO NOT OPERATE WITH ANY GUARD DISABLED, DAMAGED, OR REMOVED. Moving guards must move freely and close instantly.
- The use of accessories or attachments not recommended by the manufacturer may result in a risk of injury to persons.
- 8. When servicing use only identical replacement parts.
- 9. Only use safety equipment that has been approved by an appropriate standards agency. Unapproved safety equipment may not provide adequate protection. Eye protection must be ANSI-approved and breathing protection must be NIOSH-approved for the specific hazards in the work area.

- 10. Stay alert, watch what you are doing and use common sense when operating a power tool. Do not use a power tool while you are tired or under the influence of drugs, alcohol or medication. A moment of inattention while operating power tools may result in serious personal injury.
- 11. Industrial applications must follow OSHA guidelines.
- 12. Maintain labels and nameplates on the tool. These carry important safety information. If unreadable or missing, contact Harbor Freight Tools for a replacement.
- 13. Avoid unintentional starting.

 Prepare to begin work before turning on the tool.
- 14. People with pacemakers should consult their physician(s) before use. Electromagnetic fields in close proximity to heart pacemaker could cause pacemaker interference or pacemaker failure.
- 15. The warnings, precautions, and instructions discussed in this instruction manual cannot cover all possible conditions and situations that may occur. It must be understood by the operator that common sense and caution are factors which cannot be built into this product, but must be supplied by the operator.



Vibration Safety

This tool vibrates during use. Repeated or long-term exposure to vibration may cause temporary or permanent physical injury, particularly to the hands, arms and shoulders. To reduce the risk of vibration-related injury:

- Anyone using vibrating tools regularly or for an extended period should first be examined by a doctor and then have regular medical check-ups to ensure medical problems are not being caused or worsened from use. Pregnant women or people who have impaired blood circulation to the hand, past hand injuries, nervous system disorders, diabetes, or Raynaud's Disease should not use this tool. If you feel any medical or physical symptoms related to vibration (such as tingling, numbness, and white or blue fingers), seek medical advice as soon as possible.
- 2. Do not smoke during use. Nicotine reduces the blood supply to the hands and fingers, increasing the risk of vibration-related injury.
- 3. Use tools with the lowest vibration when there is a choice between different processes.
- 4. Include vibration-free periods each day of work.
- Grip workpiece as lightly as possible (while still keeping safe control of it). Let the tool do the work.
- To reduce vibration, maintain the tool as explained in this manual. If any abnormal vibration occurs, stop use immediately.



SAVE THESE INSTRUCTIONS.

Specifications

Electrical Rating	120VAC / 60Hz / 6.2A
Spindle Speed Range	630 - 3300 RPM
Throat Depth	5" (10" Swing)
Table Tilt	45° left and right
Table Swing Around Column	360°
Spindle Stroke	2"
Chuck to Spindle Arbor Taper	JT33
Chuck Capacity	1/2" (13mm)



Setup - Before Use



Read the <u>ENTIRE</u> IMPORTANT SAFETY INFORMATION section at the beginning of this manual including all text under subheadings therein before set up or use of this product.

AWARNING

TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION: Turn the Power Switch of the tool off and unplug the tool from its electrical outlet before performing any procedure in this section.

Note: For additional information regarding the parts listed in the following pages, refer to the Assembly Diagram near the end of this manual.

Mounting

Secure the tool to a supporting structure before use. Before assembly, bolt the Base to a flat, level, solid workbench capable of supporting the weight of the drill press and any workpieces.

Verify that installation surface has no hidden utility lines before drilling or driving screws.

Assembly

Column to Base

- Loosen Set Screw (9) in Rack Collar (78) and remove Rack Collar and Gear Rack (92) from the Column (101). The Gear Rack is stowed in this position only for transit purposes.
- 2. Place Column Base (93) on the Base (94) and align the holes in the Column Base with holes in Base.
- Attach using Bolt (102) in each hole through the Column and into the Base.



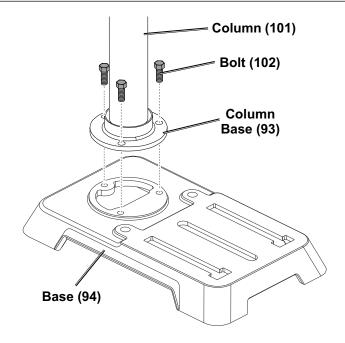


Table to Column

 Assemble Worm Gear (84) and Lock Handle (81) to the Table Support (82). Do not tighten down the Lock Handle at this time.

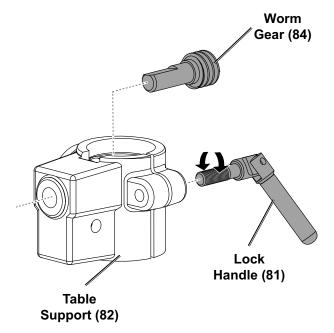

- 2. With the longer smooth end of Gear Rack (92) uppermost, place Gear Rack into notch of Table Support opening, making sure Gear Rack meshes with teeth of Inner Gear (83).
- 3. Assemble the Table (87) to the Table Support with the Angle Bolt (88).

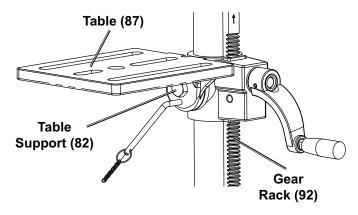


- 4. While holding Gear Rack and Table Support as assembled, slide both down onto the Column until Gear Rack bottom is positioned against Column Base.
- 5. Replace Rack Collar, beveled side down, onto Column and top of Gear Rack. Tighten Set Screw.

<u>Note:</u> Ensure that Gear Rack is not pinched. Gear Rack should move freely when Table is rotated around Column.


6. Assemble the Lift Handle (85) to the end of the Worm Gear shaft and secure it in place with the Set Screw.

<u>Note:</u> Confirm the Set Screw engages the flat surface of the Worm Gear shaft.

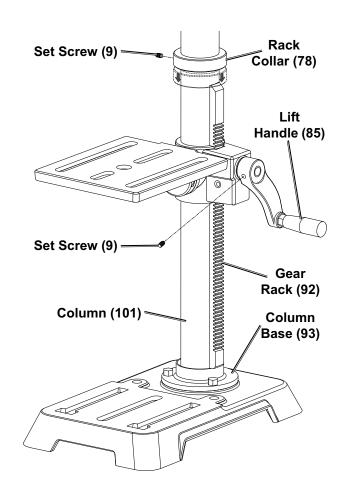


Head Assembly to Column

- 1. Loosen the Set Screw (32) on each side of the Head Assembly so they will stay clear while installing it.
- With assistance, lift the Head Assembly above the Column, and gently slide it down the Column as far as it will go. Make sure the Head Assembly slides completely onto the Column.
- 3. Align the Head Assembly with the Base, and tighten the two Set Screws to secure the Head Assembly in place.

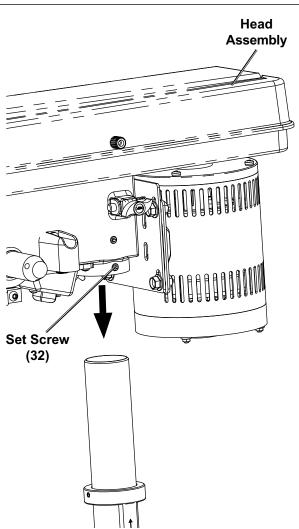


- 1. Thread the Feed Handle Bars (27) into the Feed Bar Seat (44) and tighten them.
- Thread the Feed Handle Knobs (26) onto the Feed Handle Bars and tighten them.

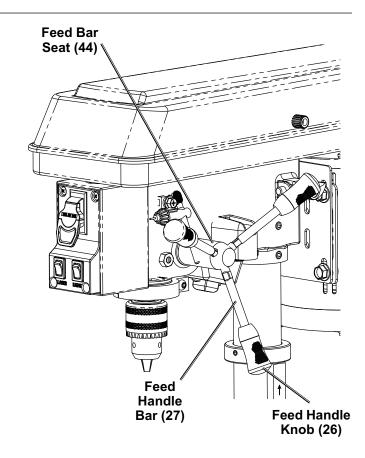

Installing/Removing the Chuck

- Loosen the Lock Handle and slide the Table up the Column to within 6" of the Spindle (71). Tighten the Lock Handle.
- Open the jaws of the Chuck (76) to their maximum, using the supplied Chuck Key.
- 3. Put a piece of scrap wood on the table to protect the Chuck nose.
- 4. Ensuring all parts are thoroughly clean, dry and burr free, place the Chuck with its open jaws on the scrap wood, directly under the Spindle.
- Use the Feed Handle to gently lower the Spindle so it is just entering the opening in the top of the Chuck.
- 6. Examine the Chuck from all sides to be sure that it is properly aligned with the Spindle.
- Using the Feed Handles, insert the Spindle all the way into the Chuck, pressing the Chuck nose hard against the piece of scrap wood on the Table to secure the Chuck into place.

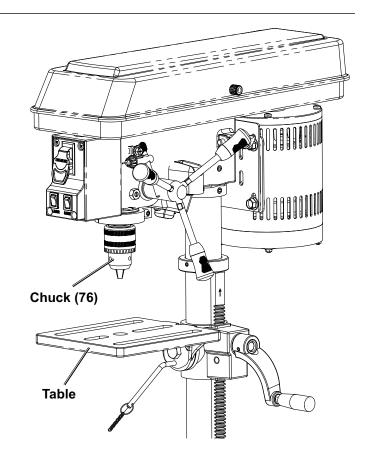

Operating Instructions



Read the <u>ENTIRE</u> IMPORTANT SAFETY INFORMATION section at the beginning of this manual including all text under subheadings therein before set up or use of this product.

Tool Set Up

AWARNING

TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION:

Turn the Power Switch of the tool off and unplug the tool from its electrical outlet before performing any procedure in this section.

TO PREVENT SERIOUS INJURY:


DO NOT OPERATE WITH ANY GUARD DISABLED, DAMAGED, OR REMOVED.

Moving guards must move freely and close instantly.

Table Adjustment

- 1. Adjust the Table (87) by loosening the Lock Handle (81), moving the Table, and tightening the Lock Handle.
- Tilt the Table by removing the Locator Pin (20), loosening the Angle Bolt (88) and tilting to the required angle. The angle can be read using the Angle Scale (72). When returning Table to zero degrees (horizontal), re-insert Locator Pin and tighten Angle Bolt.
- 3. TO ENSURE THAT THE DRILL IS ENTIRELY PERPENDICULAR TO THE TABLE, insert a straight round bar (not included) in the Chuck (76), place a square on the Table and bring it up to the round bar. Adjust the angle as needed.

<u>CAUTION!</u> To prevent injury from unexpected Table movement, tighten Angle Bolt and Lock Handle after adjustment.

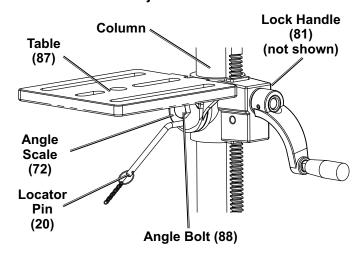


Setting a Drilling Depth

Located on the left side of the Headstock is the depth feed adjustment assembly, which allows drilling a series of holes to the same depth using one setting.

- 1. Lower the drill (with the power OFF) so that it contacts the material and hold in that position.
- Screw down the lower Adjustment Nut (65) on the Stop Rod (64) until the gap between the underside of the Nut and the Drill Stop face equals the depth of the hole required.
- 3. Screw down the upper Adjustment Nut against the lower Adjustment Nut to lock setting.


<u>Note:</u> Alternatively, drilling depth for a one-time procedure can be determined by lowering the drill (with the power OFF) until it contacts the work, noting the position of the Pointer (63) on the Scale, turning the drill ON, and drilling to the required depth using the Scale as a guide.

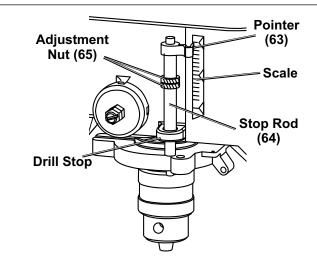

Changing Drill Speed

Before changing drill speeds, make sure the machine is switched OFF and UNPLUGGED.

- 1. Open the Pulley Cover.
- Loosen the Motor Tension Knob (42) on the Headstock, and move the Motor (14) towards the Headstock to relieve tension on the V-Belt (45).

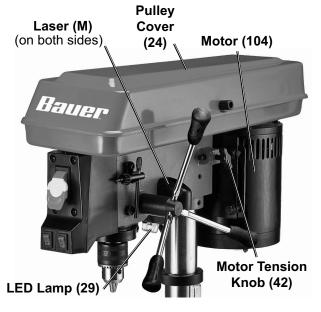

- Consult the chart below and position the V-Belt on the Pulleys (2, 17) according to the desired drill speed.
- 4. When the Belt has been correctly positioned, tighten it by pushing the Motor away from the Headstock until the Belt deflects by approximately 1/2" at its center when using reasonable thumb pressure. Lock this position in with the Motor Tension Knob.


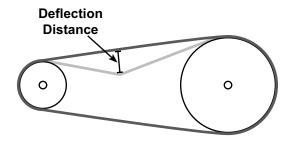


Figure A: Belt Deflection

Note: If the belt is too long to be properly tensioned, it must be replaced.

Speed Range	WO	WOOD ALUMINUM / ZINC / BRASS IRON / STEEL		ALUMINUM / ZINC / BRASS		STEEL
(RPM)	inch	mm	inch	mm	inch	mm
2000-3500	3/8	9.5	7/32	5.6	3/32	2.4
1400-2000	5/8	16.0	11/32	8.75	5/32	4.0
1000-1400	7/8	22.0	15.32	12.0	1/4	6.4
800-1000	1-1/4	31.75	11/16	17.5	3/8	9.5
200-800	1-5/8	41.4	3/4	19.0	1/2	12.5

 

The chart above shows the belt arrangements for given drill speeds. A full chart is also located on the inside of the pulley cover.

Drill Bit Installation

- 1. Insert the drill bit into the jaws of the Chuck approximately 1", ensuring that the jaws do not touch the flutes of the drill bit.
- 2. Before tightening the Chuck, ensure that the drill bit is centered within the jaws.
- 3. Tighten the Chuck securely with the included Chuck Key.

Laser Alignment


- Insert a small drill bit into the Chuck.
- Place a piece of scrap wood on the table and mark an "X" where the drill bit will contact.
- 3. Secure the workpiece to the table.

- 4. Turn on the Laser and verify the laser lines are aligned with the "X" on the workpiece.
- If the Laser lines are not aligned to the "X", Loosen the Set Screws on each Laser Housing and rotate the Laser Adjustment Knobs until the Laser lines are aligned to the "X". Retighten the Set Screws.

Workpiece and Work Area Set Up

- Designate a work area that is clean and well-lit.
 The work area must not allow access by children or pets to prevent distraction and injury.
- Route the power cord along a safe route to reach the work area without creating a tripping hazard or exposing the power cord to possible damage. The power cord must reach the work area with enough extra length to allow free movement while working.
- 3. Secure loose workpieces using a vise or clamps (not included) to prevent movement while working.
- There must not be objects, such as utility lines, nearby that will present a hazard while working.
- Set the Table height and position so that the drill travel range is sufficient for the workpiece to be drilled.
- Set the drilling depth so that the bit will not contact the table - or align the table so that the hole in its center is in line with the bit.
- 7. Make sure the work is securely clamped. That is, held in a drill vise, or bolted to the table. WARNING! <u>Do not hold the workpiece with your bare hands while drilling.</u> Severe personal serious injury may be caused if the material is flung out of the operator's hand.
- 8. IF THE MATERIAL IS IRREGULARLY SHAPED and cannot be laid flat on the table, it should be securely blocked and clamped. Any tilting, twisting or shifting will result not only in a roughly drilled hole but also increases the chances of damage to the drill.

- 9. FOR FLAT WORK, lay the piece on to a wooden base and clamp it down firmly against the table to prevent it from turning.
- 10. FOR SMALL MATERIALS that cannot be clamped to the table, use a drill press vise. Make sure the vise is clamped or bolted to the table.
- 11. WHEN DRILLING COMPLETELY THROUGH WOOD, position a piece of scrap wood between the material and the table to prevent splintering on the underside of the material as the drill breaks through. The scrap piece of wood must make contact with the left side of the column. Securely clamp the other end of the scrap wood to the table. Also, set the depth of the drill so that the drill will not come in contact with the table or align the table so that the hole in its center is in line with the drill bit.

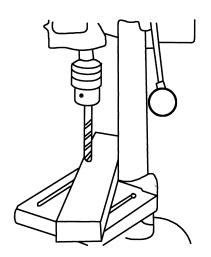

General Operating Instructions

- 1. Plug the Power Cord into an electrical outlet.
- 2. Turn on the LED Lamp if extra light is needed.
- 3. Set workpiece on Table.
- 4. Turn on the Laser to mark where the hole is to be drilled. Make minor workpiece alignment adjustments.
- 5. Turn the Drill Press on.
- Pull down on the Feed Handle and slowly drill the hole into the workpiece.
- 7. Turn Drill Press off by flipping Power Switch down.
- 8. To lock Drill Press in the OFF position, remove the safety key from Power Switch and store key in a safe place until next use.

<u>WARNING!</u> TO PREVENT SERIOUS INJURY: If the drill bit grabs and spins the workpiece, do not attempt to stop the spinning with your hands. Step back, and turn the drill press off. Wait for the spindle to stop turning before dislodging the workpiece.

9. To prevent accidents, turn off the tool and disconnect its power supply after use. Clean, then store the tool indoors out of children's reach.

Maintenance and Servicing



Procedures not specifically explained in this manual must be performed only by a qualified technician.

AWARNING

TO PREVENT SERIOUS INJURY FROM ACCIDENTAL OPERATION:

Turn the Power Switch of the tool off and unplug the tool from its electrical outlet before performing any procedure in this section.

TO PREVENT SERIOUS INJURY FROM TOOL FAILURE:

Do not use damaged equipment. If abnormal noise or vibration occurs, have the problem corrected before further use.

Cleaning, Maintenance, and Lubrication

- 1. **BEFORE EACH USE**, inspect the general condition of the tool. Check for:
 - · loose hardware
 - · misalignment or binding of moving parts
 - · cracked or broken part
 - · damaged electrical wiring
 - any other condition that may affect its safe operation.

- AFTER USE, wipe external surfaces of the tool with clean cloth.
- Periodically, wear ANSI-approved safety goggles and NIOSH-approved breathing protection and blow dust out of the motor vents using dry compressed air.
- 4. AWARNING! TO PREVENT SERIOUS INJURY: If the supply cord of this power tool is damaged, it must be replaced only by a qualified service technician.

Belt Inspection and Tensioning

 Examine V-Belt for cracks, tears in the backing, and other damage. 2. Replace V-Belt if damaged, following the instructions under Changing Drill Speed on page 10.

Troubleshooting

Problem	Possible Causes	Likely Solutions
Tool will not start.	Cord not connected.	Check that cord is plugged in.
	2. No power at outlet.	Check power at outlet. If outlet is unpowered, turn off tool and check circuit breaker. If breaker is tripped, make sure circuit is right capacity for tool and circuit has no other loads.
	Tool's thermal reset breaker tripped (if equipped).	Turn off tool and allow to cool. Press reset button on tool.
	4. Internal damage or wear. (Carbon brushes or switch, for example.)	4. Have technician service tool.
Tool operates slowly.	Extension cord too long or wire size too small.	Eliminate use of extension cord. If an extension cord is needed, use one with the proper diameter for its length and load. See Table A on page 2.
Performance decreases	Accessory dull or damaged.	Keep cutting accessories sharp. Replace as needed.
over time.	2. Carbon brushes worn or damaged.	Have qualified technician replace brushes.
Excessive noise or rattling.	Internal damage or wear. (Carbon brushes or bearings, for example.)	Have technician service tool.
	Belt (if equipped) too loose (slipping) or too tight (bearing damage).	2. Properly tension belt.
Overheating.	Forcing machine to work too fast.	Allow machine to work at its own rate.
	Accessory dull or damaged.	Keep cutting accessories sharp. Replace as needed.
	3. Blocked motor housing vents.	Wear ANSI-approved safety goggles and NIOSH-approved dust mask/respirator while blowing dust out of motor using compressed air.
	Motor being strained by long or small diameter extension cord.	4. Eliminate use of extension cord. If an extension cord is needed, use one with the proper diameter for its length and load. See Table A on page 2.



Follow all safety precautions whenever diagnosing or servicing the tool. Disconnect power supply before service.

Record Product's Serial Number Here:

Note: If product has no serial number, record month and year of purchase instead.

Note: Some parts are listed and shown for illustration purposes only, and are not available individually as replacement parts.

Visit harborfreight.com/parts for a list of in stock parts. Reference UPC 193175446558.

PLEASE READ THE FOLLOWING CAREFULLY


THE MANUFACTURER AND/OR DISTRIBUTOR HAS PROVIDED THE PARTS LIST AND ASSEMBLY DIAGRAM IN THIS MANUAL AS A REFERENCE TOOL ONLY. NEITHER THE MANUFACTURER OR DISTRIBUTOR MAKES ANY REPRESENTATION OR WARRANTY OF ANY KIND TO THE BUYER THAT HE OR SHE IS QUALIFIED TO MAKE ANY REPAIRS TO THE PRODUCT, OR THAT HE OR SHE IS QUALIFIED TO REPLACE ANY PARTS OF THE PRODUCT. IN FACT, THE MANUFACTURER AND/OR DISTRIBUTOR EXPRESSLY STATES THAT ALL REPAIRS AND PARTS REPLACEMENTS SHOULD BE UNDERTAKEN BY CERTIFIED AND LICENSED TECHNICIANS, AND NOT BY THE BUYER. THE BUYER ASSUMES ALL RISK AND LIABILITY ARISING OUT OF HIS OR HER REPAIRS TO THE ORIGINAL PRODUCT OR REPLACEMENT PARTS THERETO.

Parts List

Part	Description	Qty
1	Circlip	1
2	Spindle Pulley	1
3	Drive Sleeve	1
4	Ball Bearing	2
5	Retainer	1
6	Circlip	1
7	Screw	2 2 5 2 2
8	Laser Cover	2
9	Set Screw	5
10	Laser	2
11	Laser Base	2
12	Nut	4
13	Hex Screw	2
14	Pulley Cover Knob	1
15	Screw	6
16	Wire Clip	1
17	Motor Pulley	1
18	Wire Fix Plate	3
19	Screw	1
20	Locator Pin	1
21	Rubber Bushing	2
24	Pulley Cover	
25	Screw	5 3
26	Feed Handle Knob	3
27	Feed Handle Bar	3
28	LED Pressure Plate	1
29	LED Lamp	1
30	LED Lamp Cover	1
31	LED Lamp Base	1
32	Hex Screw	4
33	Hex Screw	2
34	Motor Plate	1
35	Motor Rod	1
36	Compressor Spring	1
37	Hex Screw	4
38	Insert Nut	2
39	Spring Pin	
40	Flat Washer	4

Part	Description	Qty
41	Headstock	1
42	Motor Tension Knob	1
43	Key Holder	1
44	Feed Bar Seat	1
45	V-Belt	1
46	Rivet	1 2 1
47	Switch Box	1
48	Switch Box Cover	1
49	On/Off Switch	1
50	Laser Switch	1
51	Circuit Board	
52	Quill Set Screw	1
53	Earth Mark	
54	Screw	4
55	Star Washer	1
56	Screw	1
57	Greece Pipe	3
58	Screw	1
59	Spring Cover	1
60	nut	3 1 1 5 2 2 2 1 1 1 2
61	Screw	2
62	nut	2
63	Pointer	1
64	Stop Rod	1
65	Adjustment Nut	2
66	Flat Washer	1
67	Circlip	
68	Ball Bearing	2
69	Rubber Pad	2 1 1
70	Quill	1
71	Spindle	1 1 1 2
72	Angle Scale	1
73	Flat Washer	1
74	nut	2
75	Hex Column Screw	1
76	Chuck	1
77	Chuck Key	1
78	Rack Collar	1

Part	Description	Qty
79	Wrench	1
80	Wrench	1
81	Lock Handle	1
82	Table Support	1
83	Inner Gear	1
84	Worm Gear	1
85	Lift Handle	1
86	Inner Gear Shaft	1
87	Table	1
88	Angle Bolt	
90	Hex Socket Screw	2
91	Table Angle Scale	
92	Gear Rack	1
93	Column Base	1
94	Base	1 1 1 2 2
95	Screw	2
96	Flat Washer	2
97	Capacitor	1
98	Capacitor Box	1
99	Flat Washer	4
100	Power Cord	1 1 3 1
101	Column	1
102	Bolt	3
103	Manual	
104	Motor	1
Α	Drive Sleeve	1
	Assembly	
В	Motor Pulley	1
	Assembly	
С	Handle Assembly	3
D E F	Motor Assembly	
Е	Quill Assembly	1
F	Rack Collar Assembly	1
G	Lift Handle Assembly	1
Н	Work Table Assembly	1
K	Column Assembly	1 1 1 2
М	Laser Assembly	2
N	Chuck & Key	1
	1	

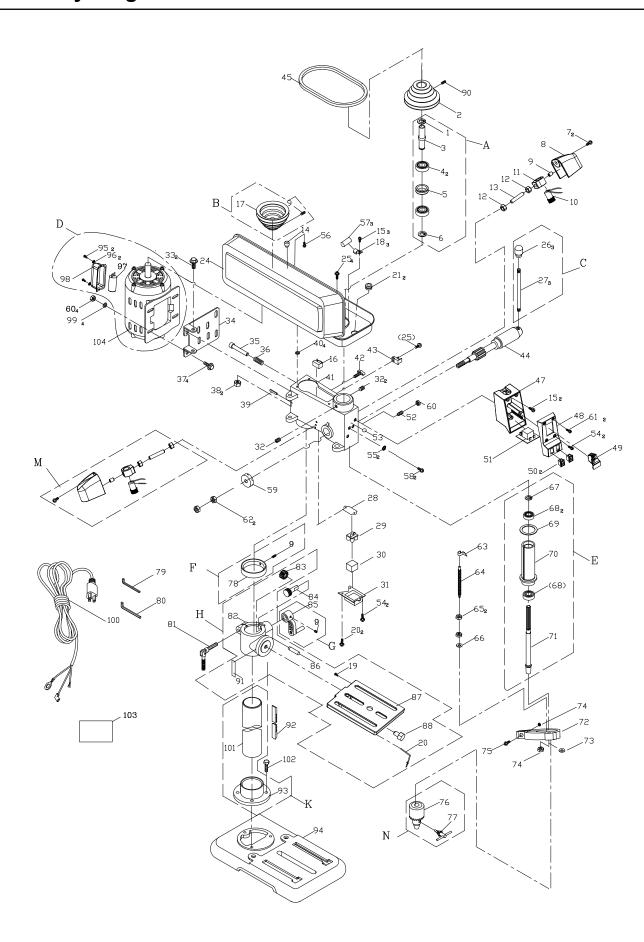

Limited 90 Day Warranty

Harbor Freight Tools Co. makes every effort to assure that its products meet high quality and durability standards, and warrants to the original purchaser that this product is free from defects in materials and workmanship for the period of 90 days from the date of purchase. This warranty does not apply to damage due directly or indirectly, to misuse, abuse, negligence or accidents, repairs or alterations outside our facilities, criminal activity, improper installation, normal wear and tear, or to lack of maintenance. We shall in no event be liable for death, injuries to persons or property, or for incidental, contingent, special or consequential damages arising from the use of our product. Some states do not allow the exclusion or limitation of incidental or consequential damages, so the above limitation of exclusion may not apply to you. THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING THE WARRANTIES OF MERCHANTABILITY AND FITNESS.

To take advantage of this warranty, the product or part must be returned to us with transportation charges prepaid. Proof of purchase date and an explanation of the complaint must accompany the merchandise. If our inspection verifies the defect, we will either repair or replace the product at our election or we may elect to refund the purchase price if we cannot readily and quickly provide you with a replacement. We will return repaired products at our expense, but if we determine there is no defect, or that the defect resulted from causes not within the scope of our warranty, then you must bear the cost of returning the product.

This warranty gives you specific legal rights and you may also have other rights which vary from state to state.

